
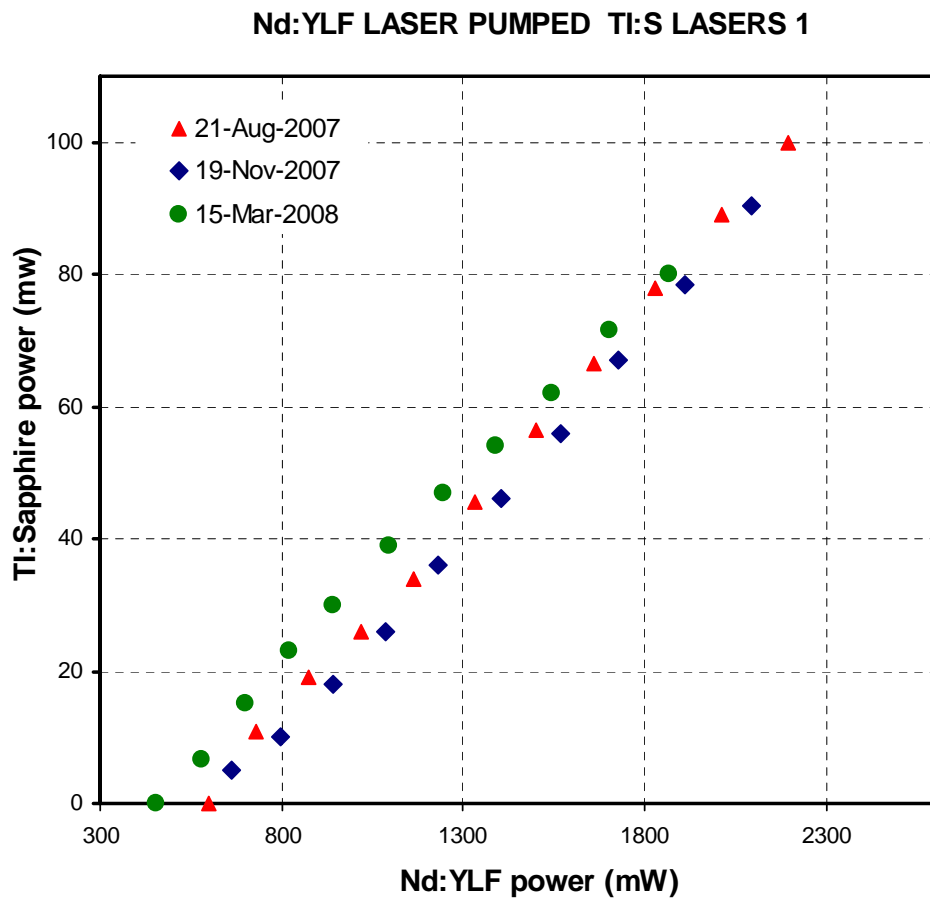


LASER1

PT 5 installation

Liyuan from 3 to 7 March 08.

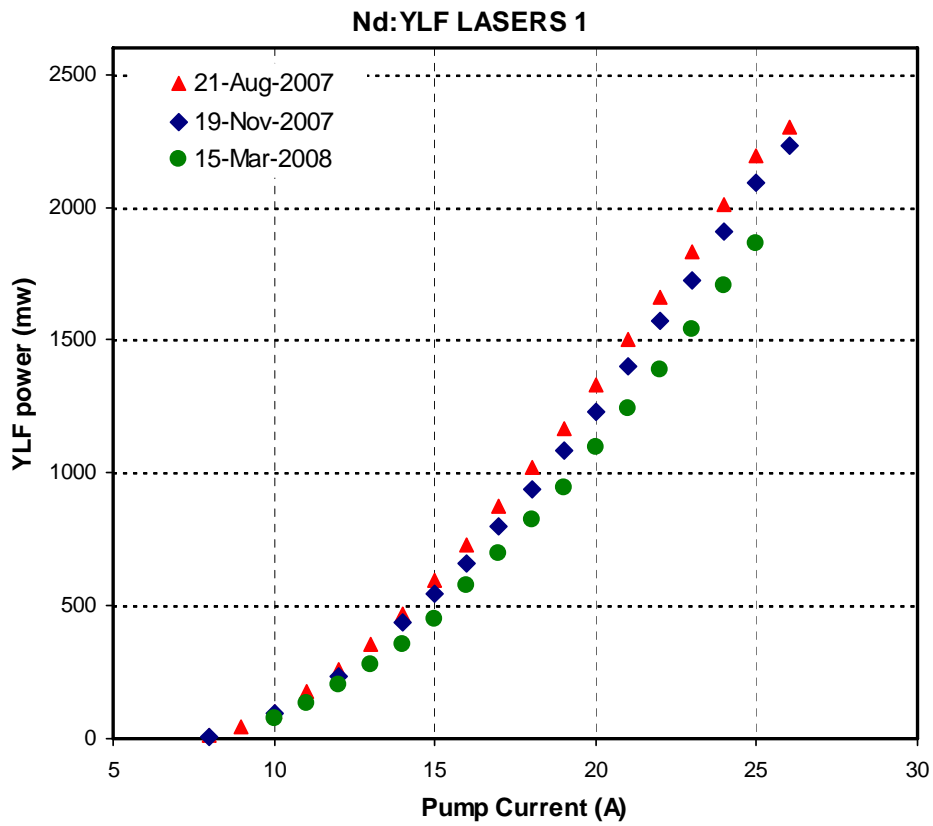

1) Change YLF Q-Switch

There was an error time to time: "Qswitch ERROR"

- Changing the RF driver didn't help so change the Qswitch

2) New Q-Switch:

same effect. YLF no stable

3) Call Quantronix

The new Q-switch and new RF driver don't have the same power : 20 mW instead of 100mW

for the original parts so mixing part is not good.

--> need to ship old part and get NEW model 20mW as spare

Need to shipped and order new RF and QSwitch.

Current A	YLF 15-Mar- 2008	440nm 15-Mar- 2008
7	T=7.8	
8		
9	35	
10	78	
11	133	
12	202	
13	280	
14	353	
15	452	T=15.1
16	580	6,5
17	700	15
18	823	23
19	943	30
20	1095	39
21	1243	47
22	1390	54
23	1543	62
24	1705	71,5
25	1865	80